S050234KD

EO 3-SAA091T09-001

Critical Item: Column/Status Driver

APR 28 1999

Find Number: 82-27061 1ea

Criticality Category: 1S

SYSTEM

AREA

CRIT TOTAL

Hypergol Vapor Detection Sys

LOA

LRU'S

SAA No:

09IT09-001

System/Area:

LPS/CCMS/FR1/FR2/CR3

18

NASA

PMN/

L72-3564-02

Part No:

NONE

82-27061

Name:

RCVS III

Mfa/ Part No: Electrospace Systems Inc./

Drawing/

Sheet No:

MCR7656 VOL. III 5.5.1 (REV K)

Function: This RCVS Critical Item is used in support of a critical user system. It decodes the column address Y), and drives the matrix switch card.

Critical Failure Mode/Failure Mode No: * Failure Mode - Erroneous Output/091T09-001.500

Fallure Cause: Electrical/Electronic failure of LRU piece part

Fallure Effect:

SYSTEM

FAILURE EFFECT

CRIT

Hypergol Vapor Detection System (LOA)

Loss of output signal will fail to provide the console operator with an input that would indicate a leak in the hypergol propellant servicing system. Loss of the capability to detect a leak during hazardous operations could result in loss of life and/or vehicle. Time to effect: Immediate. Detection method: Software detects loss of communication.

^{*} Column/Status driver failures could result in erroneous decoding of a matrix connect/disconnect command which could disconnect the FEP to HIM interface resulting in loss of the data path for the critical system being monitored/controlled.

Column/Status Driver (Continued)

APR 28 1999

ACCEPTANCE RATIONALE

Design: The Column/Status Driver was designed per the requirements of the following documents.

- 1. CP09IT0910: General design requirements specification for LPS/CCMS.
- 2. CP09IT0917: Contract end item assembly specifications for V&DA for LPS/CCMS.

These specifications support the Shuttle design and procurement philosophy procurement of hard-ware that is not undergoing development but to procure "off-the-shelf hardware" and to maximum extent possible parts previously qualified through proven design.

Test: Rigorous sets of acceptance tests were performed to verify performance and design requirements of the LPS/CCMS. This process occurred on each end item from "In Process Assembly" phase to "Site Acceptance". Master control procedures (MCPs) 78K-M401 and 78K-M701 were utilized for acceptance testing by MMC. Following this acceptance testing IBM performed integrated testing of each set. Test procedures KSC-LPS-IB-086, Book 3 and KSC-LPS-IB-105, Book 5 were utilized.

Hypergol Vapor Detection Sys

- OMRSD File VI Volume 1 requires a sensor functional test prior to each flow. OMI V3542
 "Hypergol Vapor Detection System Operations Support (LPS)" provides an end-to-end verification of the system (LPS/HVDS).
- During loading operations, personnel are stationed on the RSS to provide visual monitor.

Inspection: LPS system integrity is continuously monitored by on-line software programs. These programs provide health and status to system operators. OMRSD File VI requires inspection, oleaning, adjustments, and verification of RCVS operation. OMI C6051.01 "RCVS Subassembly (Main) PM" and C6051.02 "RCVS Subassembly (Local) PM" satisfy these OMRSD requirement. Proper RCVS operation is verified by each user system as part of the end-to-end verification of their integrated system.

Failure History:

The PRACA Data Base was used for this analyses (time frame APR. 88 to Sep. 90). There was 1 Problem Report initiated on Column/Status Drivers that relate to failure modes depicted on this CIL sheet. There is a total population of 40 Column/Status Drivers installed in various CCMS Station Sets. In the basic SAA the timeframe of Jan. 84 to Mar. 88 was used with 1 Problem Report identified from a total population of 40 drivers installed. Operation use varies from 7 days a week, 24 hours a day to as required.

EO 1-SAA09IT09-001

S050234KD

Column/Status Driver (Continued)

APR 2 8 1999

Operational Use:

• Correcting Action:

Troubleshooting required to isolate and replace failed unit.

• Timeframe:

Varies, troubleshooting required.